

Manhole Inspection Summary

Manhole # S29YY1019MH

Printed On: 12/17/2008

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **29YY1** Node: **019** Status: **New Manhole (Not in GIS)** Insp Date: **3/22/07 12:00 AM**

Incomplete Comments

Crew: **JY, JC**
Inspector: **Yi, J**
Firm: **RKK**

Location Address: **5200 CHARLES ST**

Cross Street: **AMBERLY WAY**

Manhole Type: **Inline** Location: **Grass** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **Sewer System is possibly owned by Cathedral of Mary Our Queen.**

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **2** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **16** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

Corbel Material: **Precast Concrete** ☐ Parged Type: **Flat top**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Precast Concrete** ☐ Parged

Shape: **Circular** Diameter: **42** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged ☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **1** nearest .5 ft. Azimuth: **240**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☐ Debris

Steps Count: **3** Missing: **0** ☐ Corroded

Surcharge ☒ **Evidence Of Surcharge** Depth: **1** (ft.) ☐ Active Surcharge Present

Location View



Top View



Evidence of surcharge - Bench debris.

Defect



Adjustment and Corbel infiltration.

Defect



Channel deterioration.

Manhole Inspection Summary

Manhole # S29YY1019MH

Printed On: 12/17/2008

Page 3 of 4

6 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.56** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:


Infiltration: **Evidence** Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer Pipe In @ 6 O'Clock

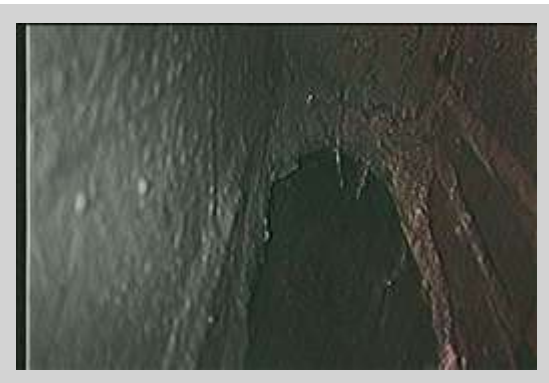

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.44** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S29YY1019MH

Printed On: 12/17/2008

Page 4 of 4

6 in. Circular Gravity Sewer
Pipe In @ 8 O'Clock



Channel deterioration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☒ Pipe Lined

Invert Depth: **5.17** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection